

TSB 05-15-12

08/08/05

FUEL FILL SLOW, OR DIFFICULT TO FILL -  
VEHICLES BUILT BEFORE 4/26/2005

FORD:  
2005 Mustang

This article supersedes TSB 05-4-8 to update the vehicle build date information.

#### ISSUE

Some 2005 Mustang vehicles built before 4/26/2005, may exhibit the [fuel tank](#) being slow or difficult to fill. The condition may be described as, repeated rapid shut-offs of the filling station pump nozzle, or multiple nozzle shut-offs when attempting to fill the fuel tank. The condition may be due to the fuel tank vapor venting system inside the fuel tank.

#### ACTION

Install a new [fuel tank](#). Refer to Section 310-01 of the Workshop Manual. The new fuel tank has a revised internal venting system to improve fuel filling.

**NOTE SOME PUMP NOZZLE SHUT-OFFS MAY BE DUE TO THE FILLING STATION PUMP DELIVERING THE FUEL TOO QUICKLY. THIS IS NORMAL.**

PART NUMBER	PART NAME
5R3Z-9002-AA	Fuel Tank

#### Parts Block

**WARRANTY STATUS:** Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

OPERATION	DESCRIPTION	TIME
051512A	2005 Mustang 4.0L SOHC:  Replace <a href="#">Fuel Tank</a> (Includes Time To Drain, Refill And Transfer Any Necessary Parts) (Do Not Use With 9002A, 9275A, 9350E)	1.8 Hrs.
051512B	2005 Mustang 4.0L SOHC Convertible: Replace Fuel Tank (Includes Time To Drain, Refill And Transfer Any Necessary Parts) (Do Not Use With 9002A, 9275A, 9350E)	2.2 Hrs.

051512C            2005 Mustang 4.6L 3V:            2.0 Hrs.  
Replace [Fuel Tank](#)  
(Includes Time To Drain,  
Refill And Transfer Any  
Necessary Parts) (Do Not  
Use With 9002A, 9275A,  
9350E)

051512D            2005 Mustang 4.6L 3V            2.4 Hrs.  
Convertible: Replace Fuel  
Tank (Includes Time To  
Drain, Refill And Transfer  
Any Necessary Parts) (Do  
Not Use With 9002A,  
9275A, 9350E)

**DEALER CODING**

BASIC PART NO.	CONDITION CODE
9002	42