

**FORD:**  
2005 Mustang

**ISSUE**

Some 2005 Mustang vehicles may exhibit the seat cushion cover front trim being loose on the front seat. The J-clip that holds the seat cushion cover trim to the front of the seat pan may not be fully engaging the flanges (slots) in the seat pan.

**ACTION**

Bend the four (4) seat pan flanges to allow proper engagement of the seat cover trim J-clips. Refer to the following Service Procedure.

**SERVICE PROCEDURE**

1. Remove the affected seat. Refer to Workshop Manual Section 501-10.
2. Pull back the seat cushion cover trim and foam to access the (4) flanges in the seat pan (Figure 1).

**NOTE**

FIGURES 1 AND 2 ONLY SHOW TWO (2) OF THE SEAT PAN FLANGES (SLOTS), THERE ARE FOUR (4) IN TOTAL.

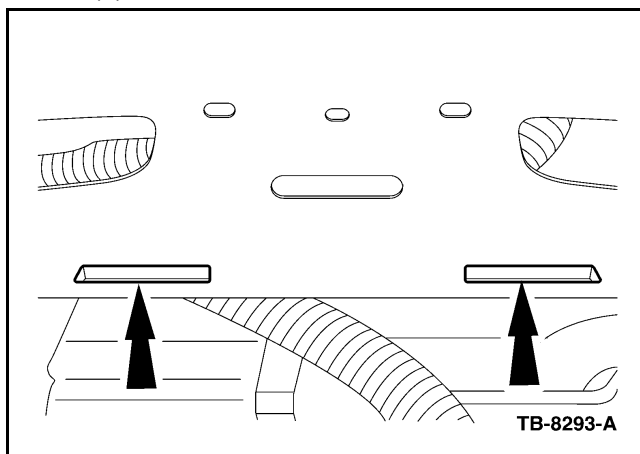


Figure 1 - Article 05-17-14

3. Using a needle nose pliers, bend the inside lip of the four (4) flanges toward the rear of the seat, to open the flange slightly. Use a dime to gauge the new opening (Figure 2). The dime should fit tightly when pushed into the adjusted flange opening.

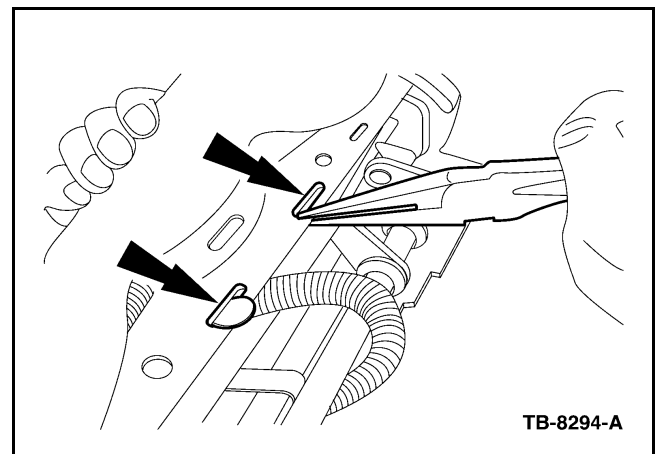


Figure 2 - Article 05-17-14

4. Reattach the seat cushion cover trim j-clip (they should snap into place). Pull slightly to check retention.
5. Reinstall seat.

**WARRANTY STATUS:** Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

OPERATION	DESCRIPTION	TIME
051714A	2005 Mustang: Adjust The 4 Flanges In The Cushion Pan Includes Time To Depower And Repower The SRS, Remove And Install Seat(S) One Seat (Do Not Use With 61704A, 61202A, 62900A, 63222A, 64416A)	0.7 Hr.

**NOTE:** The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.

## TSB 05-17-14 (Continued)

051714B      2005 Mustang: Adjust The      0.9 Hr.  
4 Flanges In The Cushion  
Pan Includes Time To  
Depower And Repower  
The SRS, Remove And  
Install Seat(S) Both Seats  
(Do Not Use With 61704A,  
61202A, 62900A, 63222A,  
64416A)

### DEALER CODING

BASIC PART NO.  
7063101

CONDITION  
CODE  
33