

## Interior - Front Seat Cushion Trim Loose

TSB 05-19-10

10/03/05

### LOOSE SEAT CUSHION COVER TRIM ON FRONT OF FRONT SEAT

FORD:  
2005 Mustang

This article supersedes TSB 05-17-14 to update the Service Procedure.

#### ISSUE

Some 2005 Mustangs built before 5/10/2005 may exhibit the seat cushion cover front trim being loose on the front seat. The J-clip that holds the seat cushion cover trim to the front of the seat pan may not be fully engaging the flanges (slots) in the seat pan.

#### ACTION

Bend the four (4) seat pan flanges to allow proper engagement of the seat cover trim J-clips. Refer to the following Service Procedure.

#### SERVICE PROCEDURE

1. Pull back the seat cushion cover trim and foam to access the (4) flanges in the seat pan (Figure 1).


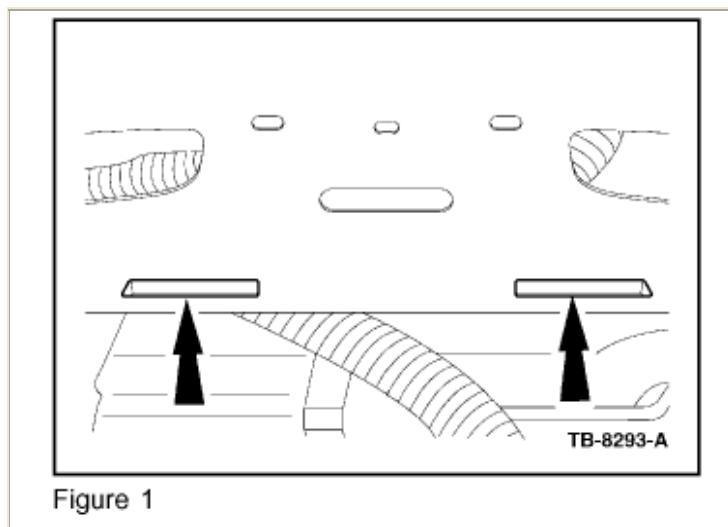


Figure 1

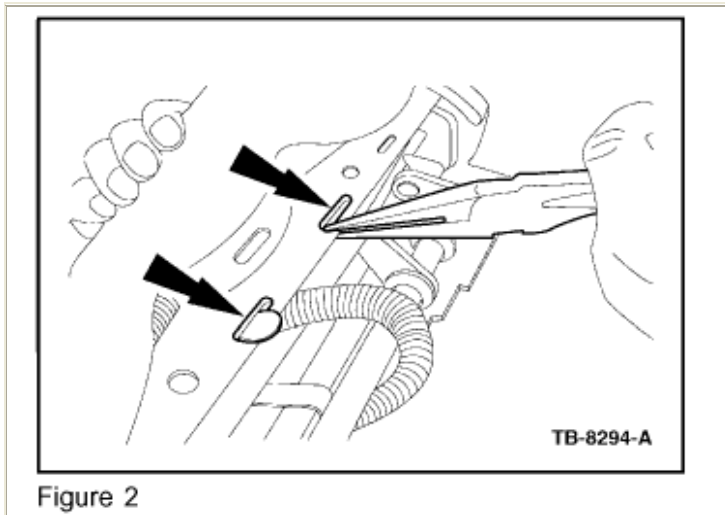

- Figure 2**
- NOTE FIGURES 1 AND 2 ONLY SHOW TWO (2) OF THE SEAT PAN FLANGES, THERE ARE FOUR (4) IN TOTAL.**
2. Using a needle nose pliers, bend the inside lip of the four (4) flanges toward the rear of the seat, to open the flange slightly. Use a dime to gauge the new opening (Figure 2). The dime should fit tightly when pushed into the adjusted flange opening.
  3. Reattach the seat cushion cover trim J-clip (they should snap into place). Pull slightly to check retention.

**WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage**

OPERATION	DESCRIPTION	TIME
051910A	2005 Mustang: Adjust The 4 Flanges In The Cushion Pan On One Seat (Do Not Use With 61704A, 61202A, 62900A, 63222A, 64416A)	0.2 Hr.
051910B	2005 Mustang: Adjust The 4 Flanges In The Cushion Pan On Both Seats (Do Not Use With 61704A, 61202A, 62900A, 63222A, 64416A)	0.3 Hr.

**DEALER CODING**

BASIC PART NO.	CONDITION CODE
7063101	24

**OASIS CODES: 101000**