

CONVERTIBLE TOP WEAR—BUILT BEFORE 10/11/2006	TSB 06-22-16
---	---------------------

FORD:

2005-2007 Mustang

This article supersedes TSB 06-19-5 to update the vehicle model years.

ISSUE

Some 2005-2007 Mustang vehicles built before 10/11/2006 equipped with a convertible top could develop wear or a hole near the 4th bow and/or number 1 bow area. This is caused by the number 1 and number 4 bow wearing or pinching through the vinyl or cloth top.

ACTION

Install a new convertible top cover, two tether straps, and add tape to the number 1 bow panel per the instruction sheet provided in the Convertible Top Kit.

SERVICE PROCEDURE

Install a new convertible top cover, tether strap, and add tape to the number 1 bow panel per the instruction sheet provided in the Convertible Top Kit.

PART NUMBER	PART NAME
7R3Z-76539B40-BA	Convertible Top Kit - (Black)
7R3Z-76539B40-BB	Convertible Top Kit - (Camel)

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

OPERATION	DESCRIPTION	TIME
062216A	2005-2007 Mustang Convertible: Replace Convertible Top Cover Includes Time To Install Tether Straps, And To Remove And Install Top Assembly (Do Not Use With 52700A, 53000A)	4.4 Hrs.

DEALER CODING

BASIC PART NO.	CONDITION CODE
7652700	30

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.

PAGE 1