

Body - Premature Convertible Top Wear

TSB 07-19-1

10/01/07

CONVERTIBLE TOP WEAR - BUILT BEFORE

10/11/2006

FORD:

2005-2007 Mustang

This article supersedes TSB 06-22-16 to update the Parts List.

ISSUE

Some 2005-2007 Mustang vehicles built before 10/11/2006 and equipped with a [convertible top](#) could develop wear or a hole near the 4th bow and/or number 1 bow area. This is caused by the number 1 and number 4 bow wearing or pinching through the vinyl or cloth top.

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

1. Install a new convertible top cover.
2. Install two (2) tether straps.
3. Add tape to the number 1 bow panel following the instruction sheet provided in the [Convertible Top Kit](#).

PART NUMBER	PART NAME
7R3Z-76539B40-BA	Convertible Top Kit - (Black Vinyl)
7R3Z-76539B40-BB	Convertible Top Kit - (Camel Vinyl)
7R3Z-76539B40-AD	Convertible Top Kit - (Black Cloth)

Parts Block

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

IMPORTANT : Warranty coverage limits/policies are not altered by a TSB. Warranty coverage limits are determined by the identified causal part.

OPERATION	DESCRIPTION	TIME
071901A	2005-2007 Mustang Convertible: Replace Convertible Top Cover Includes Time To Install Tether Straps, And To	4.4 Hrs.

Remove And Install Top
Assembly (Do Not Use
With 52700A, 53000A)

DEALER CODING

BASIC PART NO.	CONDITION CODE
7652700	30

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle.