

AIR BAG WARNING LAMP ON—DTC B2295 IN RESTRAINTS CONTROL MODULE

TSB 10-23-8

FORD:

2007-2009 Mustang

This article supersedes TSB(s) **09-08-07** to update the Part List/Service procedure.

ISSUE

Some 2007-2009 Mustang vehicles equipped with side air bags may exhibit the air bag lamp on with diagnostic trouble code (DTC) B2295 with lamp fault code 22/23 (driver/passenger seat side airbag circuit failure). This may be caused by the circuit connection in the side airbag module wire harness.

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

Replace the side airbag module as described in Workshop Manual (WSM), Section 501-20B.

PART NUMBER	PART NAME
BR3Z-63611D10-A	Air Bag Module
BR3Z-63611D11-A	Air Bag Module

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage
IMPORTANT: Warranty coverage limits/policies are not altered by a TSB. Warranty coverage limits are determined by the identified causal part.

OPERATION	DESCRIPTION	TIME
102308A	2007-2009 Mustang: Check DTCs And Replace The Right Side Airbag Module Includes Time To Depower And Repower The Supplemental Restraint System (Do Not Use With Any Other Labor Operations)	1.5 Hrs.
102308B	2007-2009 Mustang: Check DTCs And Replace The Left Side Airbag Module Includes Time To Depower And Repower The Supplemental Restraint System (Do Not Use With Any Other Labor Operations)	1.6 Hrs.
102308C	2007-2009 Mustang: Check DTCs And Replace Both Left And Right Side Airbag Modules Includes Time To Depower And Repower The Supplemental Restraint System (Do Not Use With Any Other Labor Operations)	2.4 Hrs.
DEALER CODING		CONDITION CODE
BASIC PART NO. 63611D10		28

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.